



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D206-667-101
Job Sheet 188686



008170

Part No: D206-667-101

Job Qty: 1 pcs

Part Name: Fwd Crosstube - High 206 A/B



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 1/14/19

Job Tracking No:

Due Date: 2/8/19

Created By: Jesse White

Type: Stock

Description:

Note: DWG D206-667-141 REV.D / IIN-D206-667 REV.D IPP Rev:F 05.09.01 Add holes for compatibility with Bell Skidtubes KJ/JLM IPP Rev:G 08-06-03 update as per DSI9415 (ECN1198) DD verified by:ec IPP Rev:H 08-07-28 update as per (par 08-013) DD verified by:EC IPP Rev J 09.01.06 Per ECN 08-562 EC verified by:DD IPP REV:K 11.08.05 PER ECN 11-615 DD VERF:EC IPP REV:L 12.08.20 DSI9628 revA (ECN12-631) DD VERF:JLM IPP REV:M 18.09.13 AS PER DWG D206-667-141 REV.D DD VERF:JFS

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
110	Packaging 1 - Pick Kit	1 pcs	2/8/19		0.00	0.00	Packaging 1 - 1		GP 19-01-28
							Packaging 1 - 2		
							Packaging 1 - 3		
							Packaging 1 - 4		
							Packaging 1 - 5		
120	Skidtubes - Bend - 2 - B4B	1 pcs	2/8/19		0.00	3.04	Skidtubes - Bend - B4B		GP 19-01-28
130	QC 15	1 pcs	2/8/19		0.00	0.00	QC 15 - 12		DAS 38 9-89
							QC 15 - 3		
							QC 15 - 38		
							QC 15 - 47		
							QC 15 - 49		
							QC 15 - 58		
							QC 15 - 9		
140	Crosstubes - 2 - B4B	1 pcs	2/8/19		0.00	2.80	Crosstubes - 1 - B4B		GP 19-01-30
							Crosstubes - 2 - B4B		
							Crosstubes - 3 - B4B		
							Crosstubes - 4 - B4B		
							Crosstubes - 5 - B4B		
							Crosstubes - 6 - B4B		
150	QC 5	1 pcs	2/8/19		0.00	0.00	QC 5 - 10		DAS 38 9-89
							QC 5 - 12		
							QC 5 - 17		
							QC 5 - 18		
							QC 5 - 19		
							QC 5 - 22		
							QC 5 - 24		
							QC 5 - 3		
							QC 5 - 38		

Plex 1/14/19 1:37 PM dart.white.jesse

P.T.O.

					QC 5 - 42	
					QC 5 - 43	
					QC 5 - 49	
					QC 5 - 51	
					QC 5 - 58	
					QC 5 - 68	
					QC 5 - 9	
160	Crosstubes - 3 - B4B	1 pcs	2/8/19	0.00 0.33	Crosstubes - 1 - B4B	
					Crosstubes - 2 - B4B	
					Crosstubes - 3 - B4B	GD 19-01-30
					Crosstubes - 4 - B4B	
					Crosstubes - 5 - B4B	
					Crosstubes - 6 - B4B	
170	QC 7	1 pcs	2/8/19	0.00 0.00	QC 7 - 10	
					QC 7 - 13	
					QC 7 - 14	
					QC 7 - 15	
					QC 7 - 17	
					QC 7 - 18	
					QC 7 - 19	
					QC 7 - 2	
					QC 7 - 28	
					QC 7 - 3	
					QC 7 - 30	
					QC 7 - 34	
					QC 7 - 36	
					QC 7 - 37	DAS
					QC 7 - 38	38
					QC 7 - 41	9-89
					QC 7 - 47	
					QC 7 - 48	
					QC 7 - 51	
					QC 7 - 58	
					QC 7 - 59	
					QC 7 - 6	
					QC 7 - 60	
					QC 7 - 9	
					QC 7 - 68	
180	Outsource - 2 - NDT per QSI038	1 pcs	2/8/19	0.00 0.00		CC 19-02-05
190	Packaging 2-1 - Receive - B4B	1 pcs	2/8/19	0.00 0.00	Packaging 2 - 1 - B4B	
					Packaging 2 - 2 - B4B	
					Packaging 2 - 3 - B4B	FEB 06 2019
200	QC 5	1 pcs	2/8/19	0.00 0.00	QC 5 - 10	
					QC 5 - 12	
					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
					QC 5 - 24	
					QC 5 - 3	
					QC 5 - 38	
					QC 5 - 42	
					QC 5 - 43	
					QC 5 - 49	
					QC 5 - 51	
					QC 5 - 58	DAS
					QC 5 - 68	FEB 11 2019 68
					QC 5 - 9	9-89
210	Spray Paint - 2 - B4B	1 pcs	2/8/19	0.00 0.88	Spray Paint - 1 - B4B	RD 19-2-6

230	Spray Paint - 3 - B4B	1 pcs	2/8/19	0.00 0.88	Spray Paint - 2 - B4B	
					Spray Paint - 3 - B4B	
					Spray Paint - 4 - B4B	
					Spray Paint - 1 - B4B	R.D 19-2-6
					Spray Paint - 2 - B4B	
					Spray Paint - 3 - B4B	
					Spray Paint - 4 - B4B	
					QC 14 - 15	
					QC 14 - 2	
					QC 14 - 34	
240	QC 14	1 pcs	2/8/19	0.00 0.00	QC 14 - 38	
					QC 14 - 41	AB 19-2-11
					QC 14 - 51	
					QC 14 - 58	
					QC 14 - 59	
					QC 14 - 9	
					QC 14 - 68	
					Crosstubes - 1 - B4B	R.D. 19-2-11
					Crosstubes - 2 - B4B	
					Crosstubes - 3 - B4B	
250	Crosstubes - 4 - B4B	1 pcs	2/8/19	0.00 2.80	Crosstubes - 4 - B4B	
					Crosstubes - 5 - B4B	
					Crosstubes - 6 - B4B	
					QC 5 - 10	
					QC 5 - 12	
					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
					QC 5 - 24	
260	QC 5	1 pcs	2/8/19	0.00 0.00	QC 5 - 3	
					QC 5 - 38	
					QC 5 - 42	
					QC 5 - 43	
					QC 5 - 49	
					QC 5 - 51	
					QC 5 - 58	
					QC 5 - 68	FEB 15 2019 DAS 68-9-89
					QC 5 - 9	
270	Packaging 1-2 - Pick Kit - B4B	1 pcs	2/8/19	0.00 0.00	Packaging 1 - 1 - B4B	
					Packaging 1 - 2 - B4B	
					Packaging 1 - 3 - B4B	FEB 15 2019 DAS 6-9-89
					Packaging 1 - 4 - B4B	
					Packaging 1 - 5 - B4B	
					QC 4 - 26	
					QC 4 - 28	
					QC 4 - 38	
					QC 4 - 42	
					QC 4 - 58	
280	QC 4	1 pcs	2/8/19	0.00 0.00	QC 4 - 6	
					QC 4 - 69	FEB 19 2019 DAS 69-9-89
					QC 4 - 9	
					Packaging 3 - 1 - B4B	FEB 19 2019 DAS 69-9-89
					Packaging 3 - 2 - B4B	
					Packaging 3 - 3 - B4B	
					Packaging 3 - 4 - B4B	
					Packaging 3 - 5 - B4B	
					DC - 1 - B4B	DAS 21 FEB 19 2019
					DC - 2 - B4B	

300 QC 21 - FG

1 pcs

2/8/19

0.00 0.00

QC 21 - FG - 21

Part Op 120 - (CNC Delta 100 Bender), Bend tube as per Dwg D206-667-141 using CNC bender program 206B-fw ar
Descriptions: FT

130 - (QC15- Crosstube Dimensional Check)

140 - ***** ENSURE PROPER JIG POSITIONING ***** 1-Drill holes & ream using drill Jig DT8541 & DT8542 as per Dwg D206-667-141. Drill all (3) top holes. 3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins. 4-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg D206-667-141. Drill only the top (2) holes. 5-Drill pilot holes as per Dwg D206-667-141. Drill only the top (2) holes. 6-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-141. Note: Fwd side has 3x top holes. 7-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D206-667-141. 8-C'sink holes as per Dwg D206-667-141. Allow rivet to sit below surface to compensate for paint. 9-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-141 Inside of Cuff(Do not engrave on outside of tube) 10-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-141

150 - (QC5- Inspect part completeness to step on W/O) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

160 - (Crosstubes Chemical Conversion) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1- CLEAN CROSSTUBE WITH WASH'N WIPE

170 - (QC7-Inspect Chemical Conversion Coat)

180 - (Outsource process - NDT per QSI038 4.1) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Level 2 Attach copy of NDT results to work order

190 - (Receive & Inspect for Damage & Mat'l Certs) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Ensure copy of NDT results attached to work order.

200 - (QC5- Inspect part completeness to step on W/O) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D206-667-103

210 - (Spray Paint / NDT Room) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** ***MASK AREA UNDER CLAMP PRIOR TO PAINTING AS PER DWG DEO*** 1-Prime inside and outside crosstube as per QSI 005 4.2.1 *****Let tube sit up right for 30mins before hanging***** P4500-P-23 Base Batch: 5143704 P4500-C-23

Catalist Batch: _____ Start time: _____ Finish: _____

230 - (Spray Paint / NDT Room) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1-Paint outside crosstube with White Imron as per QSI 005 4.2 Imron 55U white paint Batch: 5146086 Imron 125S activator Batch: _____ Start: _____

240 - (QC14- Inspect Spray Paint)

250 - INSTALL GROUNDING CLAMP AND SEAL WITH SIKAFLEX AS PER DWG A/R SIKAFLEX

BATCH: 5138976 Proseal -Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg 2-Install supports with Proseal 890 per D206-667-141 and QSI 015 A/R Proseal 890 Batch: 5138976 EXP: 6/19 3-Install supports clamps Using Dt9565 as per Dwg D206-667-141 Torque to 80-100 IN-LBS. Start: 19-2-11 Finish: 19-2-14 4-Install nut plates as per Dwg D206-667-141. Touch-up rivet heads with Imron paint.

260 - (QC5- Inspect part completeness to step on W/O) ***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.*** ***VERIFY RESISTANCE AS PER NOTE 18 AND DWG ***

280 - (QC4- 100% Inspect kits for completeness)

290 - (Identify as per dwg & Stock Location: _____), Identify and pack for shipping as per PPP D206-667-101

295 - Photocopy bluefile and create labels as per PPP D206-667-101 CHG005

300 - (QC21- Final Inspection - Work Order Release)

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D206-667-101TRN	Crosstube Turning Detail	1 Ea (1 ea)	110-Packaging 1 - Pick Kit	<u>B135102</u>
D2873-043	Nut Plate Assembly	2 Ea (2 ea)	250-Crosstubes - 4 - B4B	
D2873-045	Nut Plate Assembly	2 pcs (2 ea)	250-Crosstubes - 4 - B4B	
D2891-1	Support 2.25	2 Ea (2 ea)	250-Crosstubes - 4 - B4B	
D3595-063-395	Rubber Cushion 0.63" Wide X 3.95" Long	4 pcs (4 ea)	250-Crosstubes - 4 - B4B	
MS20601-AD4W8	Rivet	14 Ea (14 ea)	250-Crosstubes - 4 - B4B	
MS21920-20	Clamp	4 Ea (4 ea)	250-Crosstubes - 4 - B4B	
AN742D36	Plain Clamp Loop	2 Ea (2 ea)	250-Crosstubes - 4 - B4B	
MS21042-3	Nut	2 Ea (2 ea)	250-Crosstubes - 4 - B4B	
MS27039-1-08	Screw	2 Ea (2 ea)	250-Crosstubes - 4 - B4B	
MS9165-05	Bracket	2 Ea (2 ea)	250-Crosstubes - 4 - B4B	
NAS1149C0332R	Washer	4 Ea (4 ea)	250-Crosstubes - 4 - B4B	
AN5-30A	Bolt	4 Ea (4 ea)	270-Packaging 1-2 - Pick Kit - B4B	<u>5104362</u>
AN5-32A	Bolt	4 Ea (4 ea)	270-Packaging 1-2 - Pick Kit - B4B	<u>5058983-1</u>
AN5-7A	Bolt	10 Ea (10 ea)	270-Packaging 1-2 - Pick Kit - B4B	<u>PM123355</u>
MS21042L5	Nut	4 Ea (4 ea)	270-Packaging 1-2 - Pick Kit - B4B	<u>5093592</u>
NAS1149D0563J	Washer	18 Ea (18 ea)	270-Packaging 1-2 - Pick Kit - B4B	<u>5123450</u>

Job Allocations				
Operation	Component Part	Required	Inventory	Allocated
110-Packaging 1 - Pick Kit	D206-667-101TRN	1	8	0
250-Crosstubes - 4 - B4B	AN742D36 S04455	2	39	0
	D2873-043 S133736	2	35	0
	D2873-045 S125817	2	32	0
	D2891-1	2 S140903	12	0
	D3595-063-395	4 S039983	91	0
	MS20601-AD4W8 S066961	14	170	0
	MS21042-3 S144420	2	124	0
	MS21920-20	4 S103843	143	0
	MS27039-1-08 S104017	2	517	0
	MS9165-05 S003262	2	25	0
	NAS1149C0332R S143145	4	3,850	0
270-Packaging 1-2 - Pick Kit - B4B	AN5-30A	4	59	0
	AN5-32A	4	453	0
	AN5-7A	10	3,200	0
	MS21042L5	4	334	0
	NAS1149D0563J	18	1,164	0
Part Specifications				
Specifications could not be found.				



Container No: S148642



Part: D206-667-101

Job No: 188686

Serial No/Batch: S148642

Revision: D/D

Inspector:


Exp Date:

Instructions: TC STC SH01-5 Issue 3, FAA STC SR01304NY 05/12/15, JCAB JAI

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 813 632-6200
Email: sales@dartaero.com
www.dartaerospace.com

Plex 1/14/19 1:37 PM dart.white.jesse

Required Dimension	Min	Max
Height	19.41	19.67
1/2 Span	36.47	36.73
Angle	65	67
Total Span	72.94	73.46
Bending Passes	12	—
Crushing	—	6%

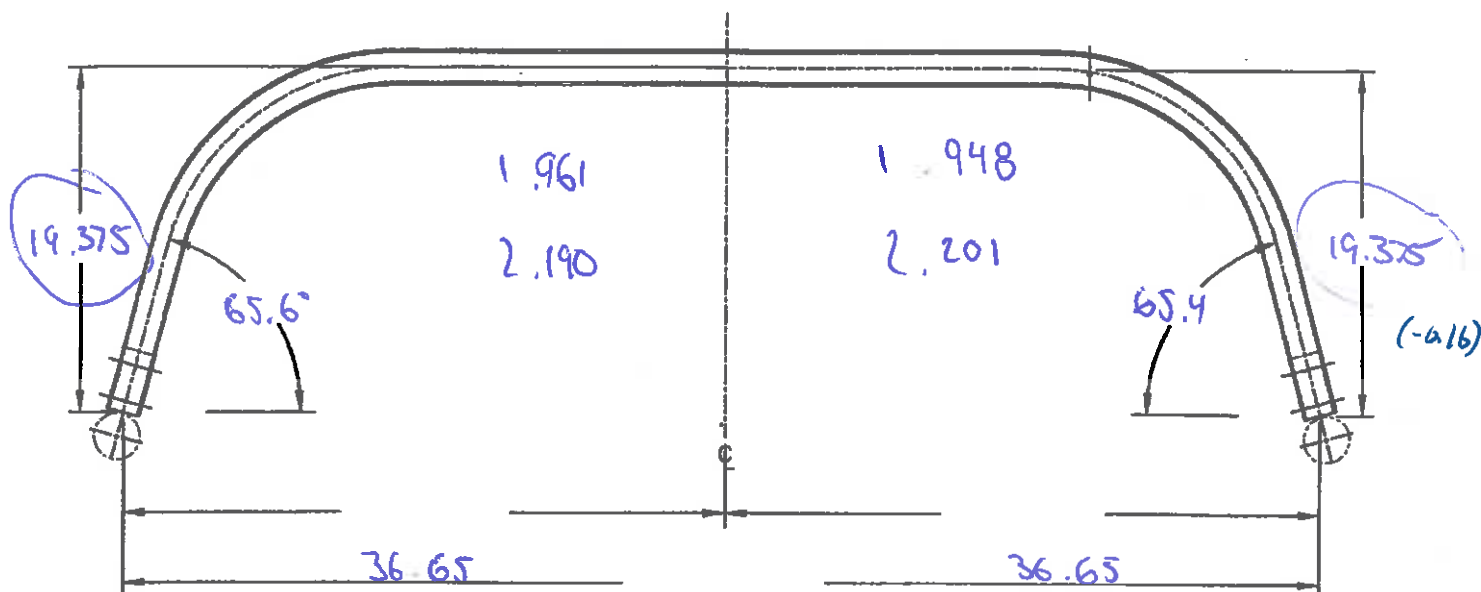

	Side A	Side B
Bending Passes	20	20
Crushing	5.5%	6.1%
Comments		

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.07.30	Dimensions revised per Dwg Rev C	KJ	
C	12.04.16	Added bending, crushing dimensions	KJ <i>LA</i>	<i>up</i>

Item	Qty	Part Number	Description
1	X	D208-887-141	CROSSTUBE ASSEMBLY (208B HIGH FWD)
2	1	D6001-105	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-385	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20801AD4W8	RIVET (OR NAS9302B-4-8)
9	AR	PROSEAL 880 B-2	SEALANT, AMIS-S-8802 CLASS B-2
10	2	AN742D38	CLAMP
11	2	MS9165-05	ANGLE BRACKET
12	2	MS21042L3	NUT (OR MS21042-3)
13	2	MS27038-1-08	SCREW
14	4	NAS1149C0332R	WASHER (OR AN860C10L)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6001-105
FINISHED LENGTH = 93.1850.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D208-887-141" AND BATCH NUMBER ON INSIDE OF CLIFF USING VIBRATING STYLUS.
- 7) WEIGHT: 11.3 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 12 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 8% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) TO INSTALL D2891-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 880 CLASS B-2 (OR AMS-9-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-385 RUBBER CUSHIONS TO SECURE THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 880 SEALANT HAS CURED FOR 72 HOURS.
- 16) MASK AREA UNDER CLAMP PRIOR TO PAINTING.
- 17) SEAL EDGES WHERE AN742D38 CLAMP MEETS WITH THE CROSSTUBE USING SIKAFLEX-241H-281 OR MIL-S-8802 CLASS B2 OR PROSEAL 880 SEALANT.
- 18) PERFORM RESISTANCE CHECK TO ENSURE MAX RESISTANCE IS 10 MILLION LBS.

RELEASED


2018 SEP 06
E-N 18-777

D	REVISE SHEET 2 ASSEMBLY DETAIL HOLE PATTERN PER CAR18-201. UPDATE PARTS LIST AND GENERAL NOTES 12 & 13 TO INCORPORATE DEC C-4. ADD ITEMS 10-14 TO PARTS LIST AND ADD GENERAL NOTES 16-18 AND ADD SHEET 5 TO INCORPORATE DEC C-2.	JMH	18.05.01
C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-385 WAS D2868-400-694 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCES (ZN C4-3, C5-3 & D3-3); RELOCATED FLAG #8 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.08
B	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT10A SKIDTUBES	PH	05.07.28
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	JMH		
DRAWN	JMH		
CHECKED	ZF		
MFG. APPR.	D208-887-141	DRAWING NO.	REV. D
APPROVED		TITLE	SHEET 1 OF 5
DE APPR.			SCALE
DATE	18.05.01	CROSSTUBE ASSY (208B HIGH FWD)	N78

COMP. PREPARED BY DART AEROSPACE LTD
AND IS SUBJECT TO THE SAME VARIATION TOLERANCE
NOT TO BE USED FOR PRODUCTION PURPOSES

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA


1 2 3 4 5 6 7 8

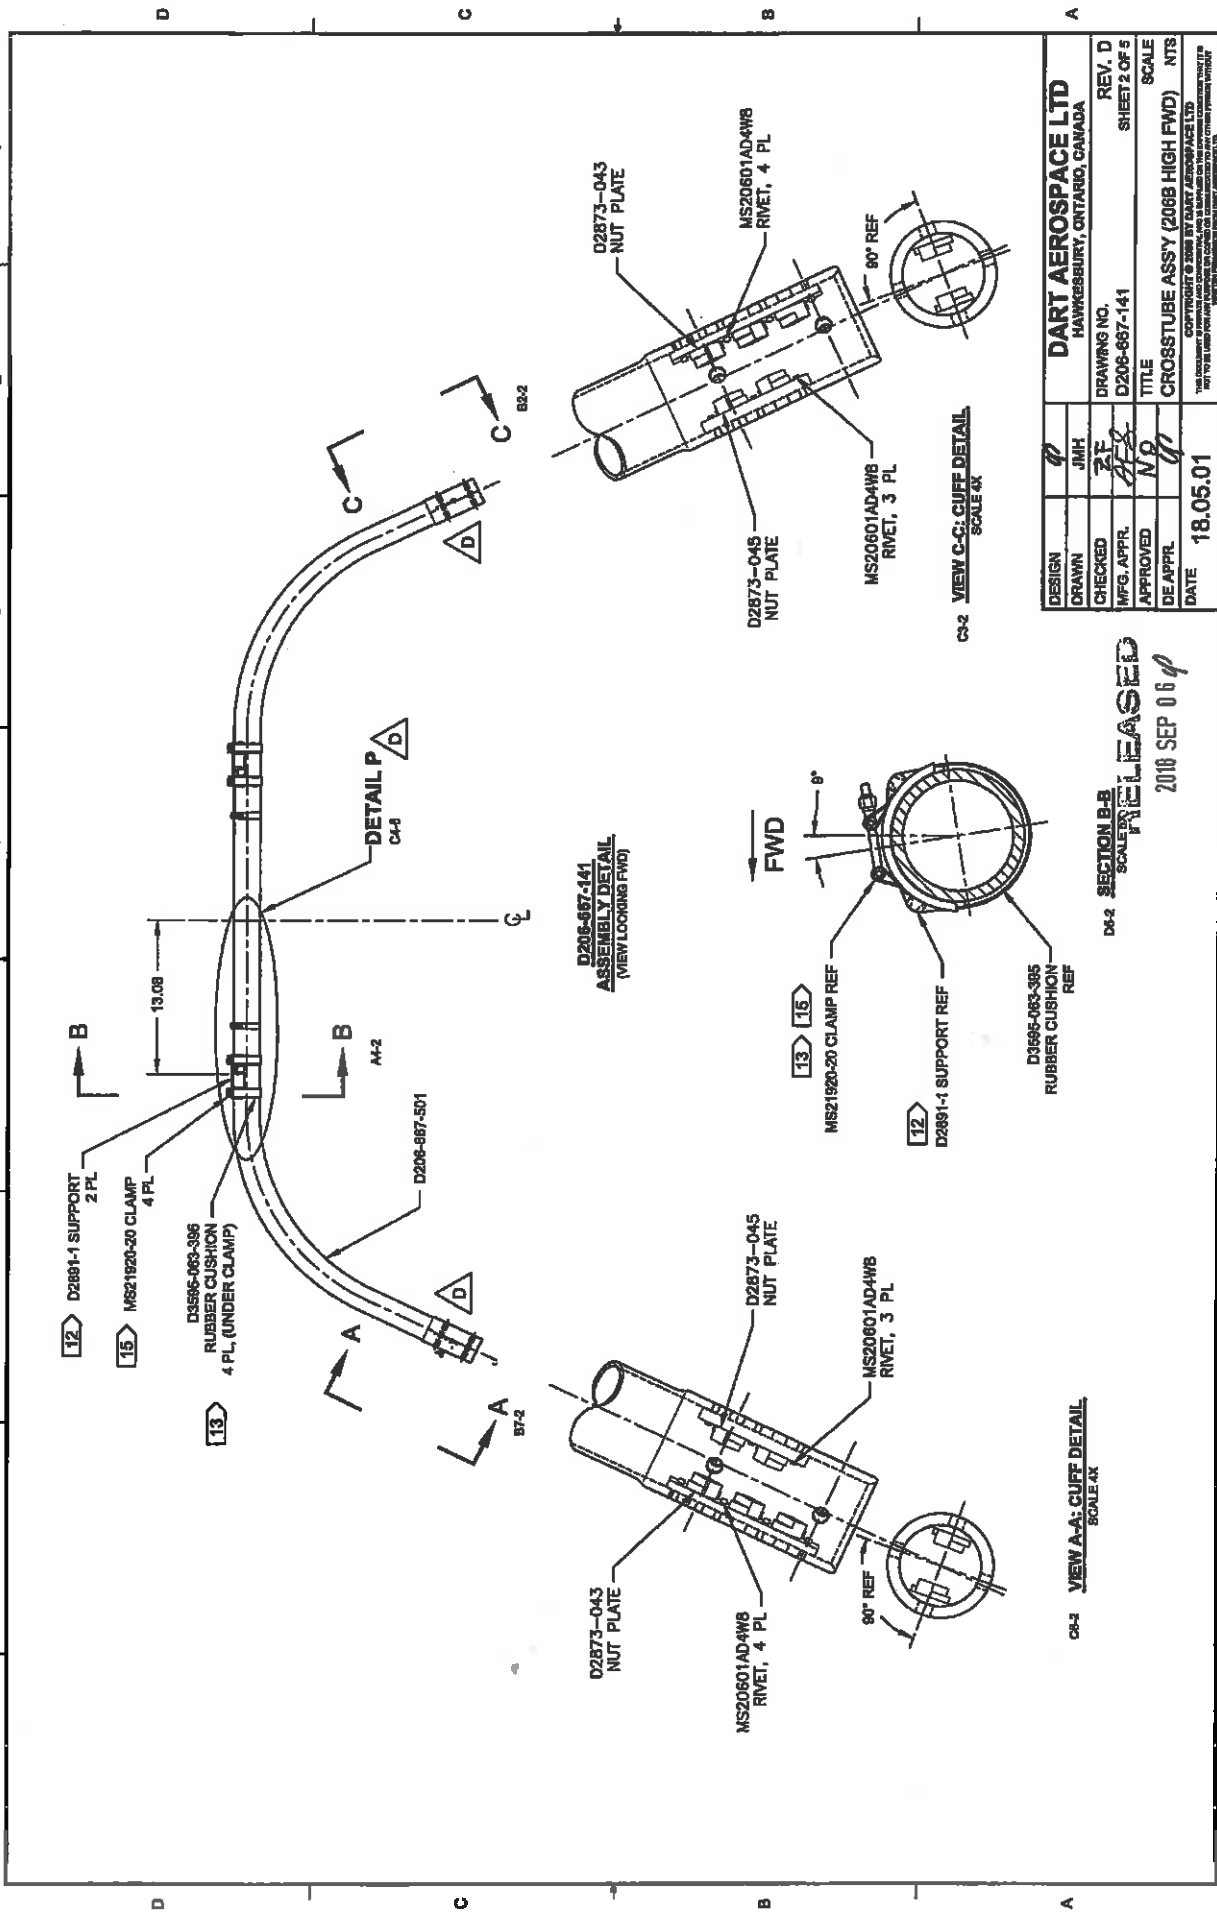


DESIGN	JMH	DART AEROSPACE LTD	REV. D
DRAWN	JMH	HAWKESBURY, ONTARIO, CANADA	
CHECKED	JF	DRAWING NO.	SHEET 2 OF 5
INFO. APPR.	JF	D208-887-141	
APPROVED	NP	TITLE	SCALE
DATE	18.05.01	CROSSSTUBE ASSY (206B HIGH FWD)	NTS

2010 SEP 06
RELEASED
D208-887-141


Copyright © 2008 by Dart Aerospace Ltd.
This drawing is the property of Dart Aerospace Ltd. and is not to be reproduced without the written permission of Dart Aerospace Ltd.

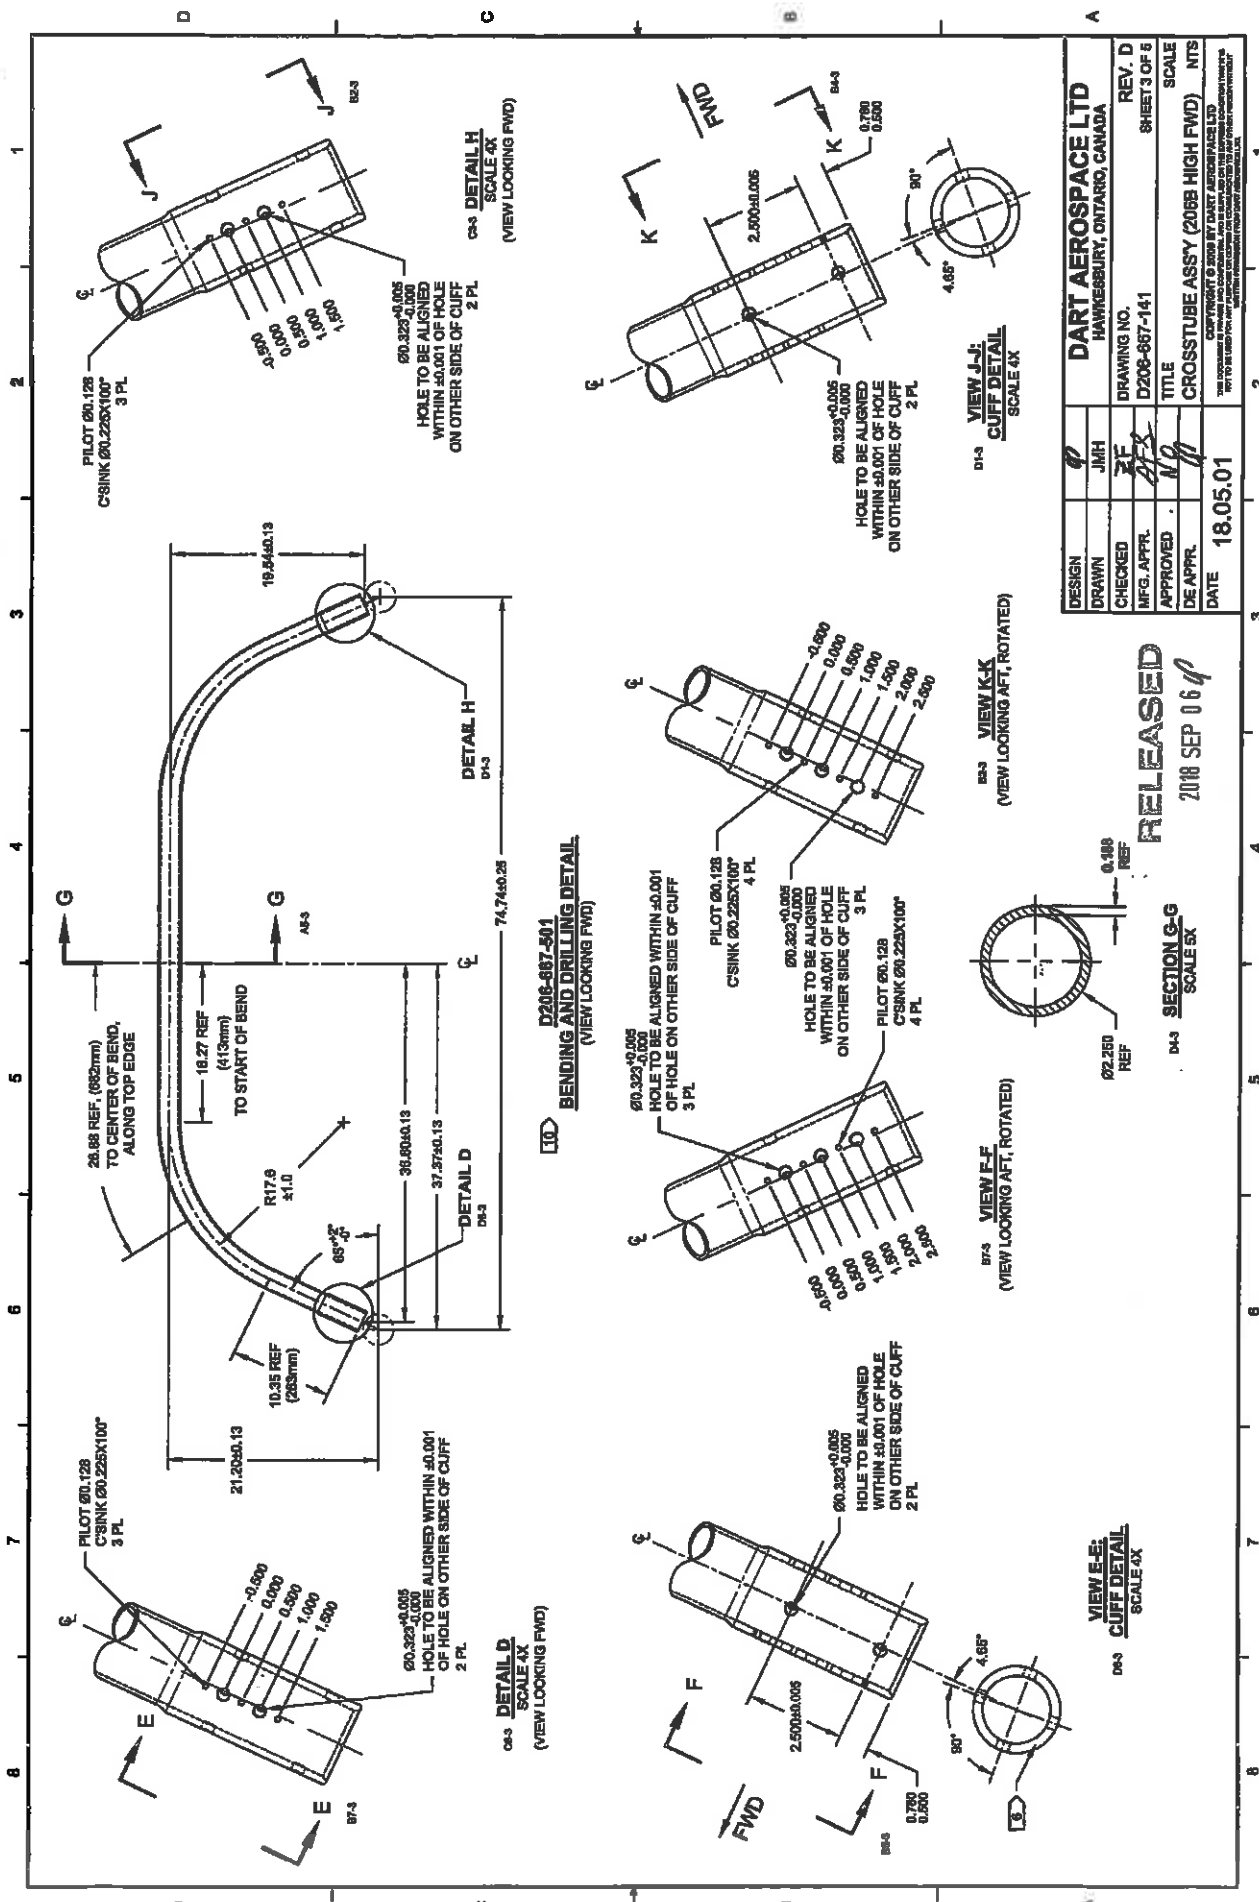


1 2 3 4 5 6 7 8

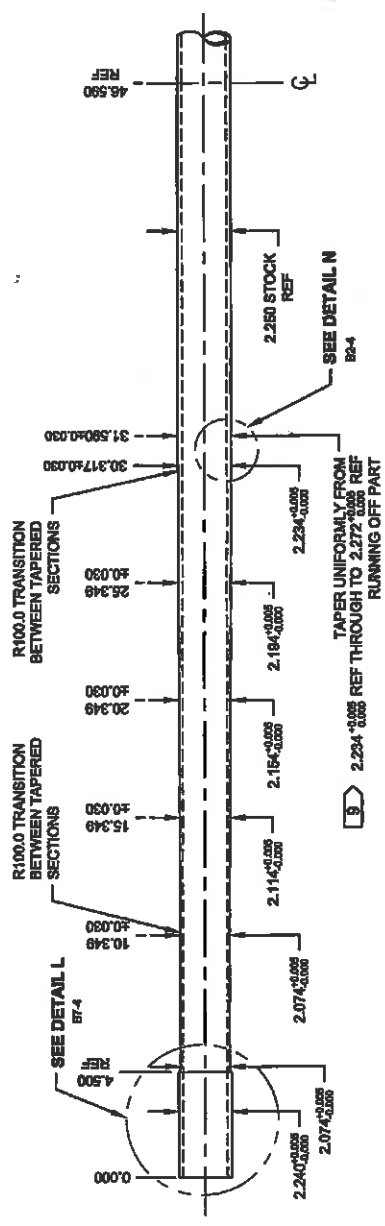


TURNING DETAIL

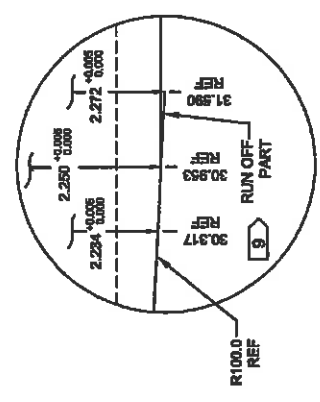

DETAIL N:
C4-4 TAPER RUN-OFF
NOT TO SCALE

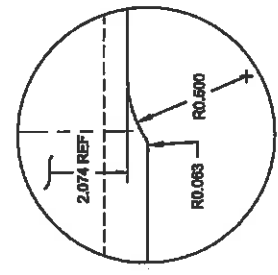

DETAIL M:
A4-4 CUFF TRANSITION
NOT TO SCALE

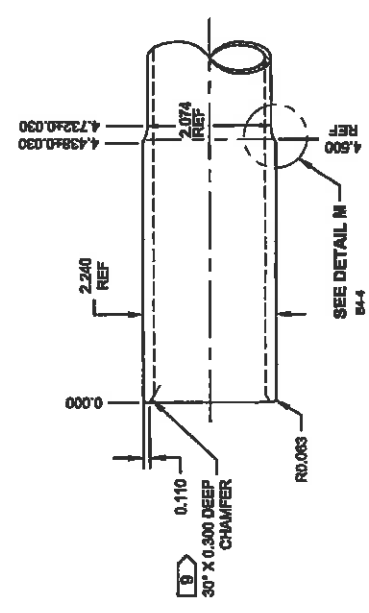


DETAIL L:
D7-4 CROSS-TUBE CUFF
NOT TO SCALE

DESIGN	φ	DART AEROSPACE LTD	REV. D
DRAWN	JMH	HAWTHORNE, ONTARIO, CANADA	SHEET 4 OF 5
CHECKED	ZF	DRAWING NO.	D200-087-141
MFG. APPL.	ZF	TITLE	CROSS-TUBE ASSY (208B HIGH FWD) NTS
APPROVED	N/D	SCALE	
DE APPL.	φ	DATE	18.05.01

RELEASED
2018 SEP 06

PROPERTY OF DART AEROSPACE LTD
THIS DOCUMENT IS UNCLASSIFIED
FOR THE PUBLIC RELEASE OF INFORMATION TO THE PUBLIC

8 7 6 5 4 3 2 1

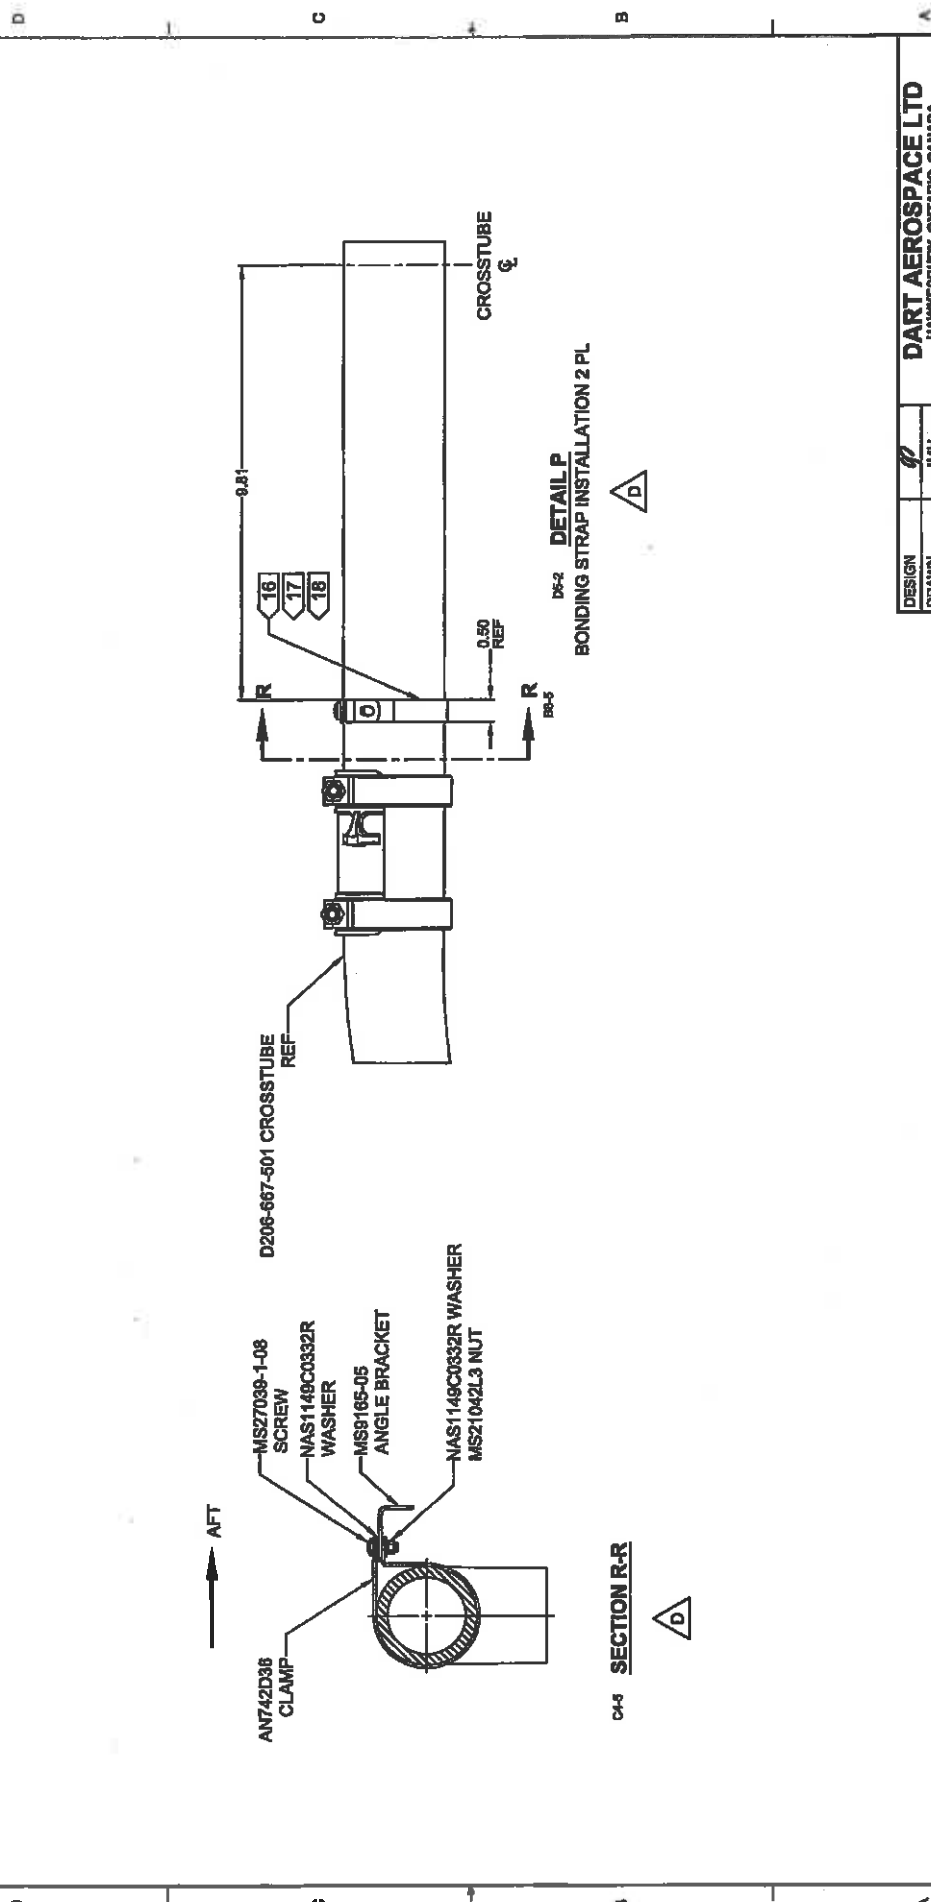

AFT

AN742D38 CLAMP
MS27038-1-08 SCREW
NAS1149C0332R WASHER
MS9165-05 ANGLE BRACKET
NAS1149C0332R WASHER
MS21042L3 NUT

D206-667-501 CROSSTUBE REF

CROSSTUBE

DETAIL P
BONDING STRAP INSTALLATION 2 PL

SECTION R-R



DESIGN	00	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA
DRAWN	JMH	
CHECKED	ZF	DRAWING NO. REV. D
MFG. APPR.	ZF	D206-687-141 SHEET 3 OF 5
APPROVED	NO	TITLE SCALE
DE APPR.	11	CROSSTUBE ASSY (206B HIGH FWD) INT8
DATE	18.05.01	

RELEASED
2018 SEP 06

COPYRIGHT © 2001 BY DART AEROSPACE LTD
ALL RIGHTS RESERVED. NO PART OF THIS DOCUMENT MAY BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, WITHOUT PERMISSION IN WRITING FROM DART AEROSPACE LTD.

8 7 6 5 4 3 2 1



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER PO042487

A PURCHASE ORDER IS A REQUEST FOR GOODS OR SERVICES. IT IS A LEGAL DOCUMENT AND SHOULD BE TREATED AS SUCH.

Natasha!

Supplier: SKY002-VC
Skyservice
6120 Midfield Road
Mississauga
ON
L5P 1B1 Canada
Phone: 905-678-5636
Fax: 905-678-5841

PO No:
PO Date
Due Date
Purchas
Revisor
Revisor
Ship-To

You can receive all
the lines except the
last one. I only get pricing
once the part is complete
and it still isn't ready.

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

Via:
Pymt Te
Freight
Special



Items

Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	188444	D212-664-107	Fwd Crosstube - Low Standard : TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA STC EASA.IM.R.S.01304 07/03/06, DGAC MEXICO STC IA- 316/2015 15/06/17 (Outsource process - NDT per QSI038 4.1) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***	Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
	188445			Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
Sub Total:							2	0	2		\$239.00

1 X FEB 06 2019

2	189456	D212-664-101	Fwd Crosstube - High : TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA STC EASA.IM.R.S.01304 07/03/06, DGAC MEXICO STC IA- 316/2015 15/06/17 *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order	Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
	189457			Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
Sub Total:							2	0	2		\$239.00

1 X FEB 06 2019

1 X FEB 06 2019



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER PO042487



Items											
Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
3	189169	D212-664-201	Aft Crosstube - High : TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA STC EASA.IM.R.S.01304 07/03/06, DGAC MEXICO STC IA-316/2015 15/06/17 ***WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.*** Issue P/O: LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2	Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
	183772			Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
Sub Total:							2	0	2		\$239.00
4	188686	D206-667-101	Fwd Crosstube - High 206 A/B : TC STC SH01-5 Issue 3, FAA STC SR01304NY 05/12/15, JCAB JAPAN STC-32-OSA 02/02/28, EASA STC EASA.IM.R.S.01179 06/07/03, BRAZIL 2009S08-16 09/08/25, BRAZIL 2009S08-17 09/08/25 (Outsource process - NDT per QSI038 4.1) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Level 2 Attach copy of NDT results to work order (Outsource process - NDT per QSI038 4.1) *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Level 2 Attach copy of NDT results to work order	Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
	188683			Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
	188684			Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
	188685			Firmed	-	2/8/19	1 pcs	0 pcs	1 pcs	\$119.50/pcs	\$119.50
Sub Total:							4	0	4		\$478.00
5	187763	D4880-1	Strut : Various STC's	Firmed	-	2/8/19	8 pcs	0 pcs	8 pcs	\$11.00/pcs	\$88.00
Grand Total:										\$1,283.00	



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER

PO042487



Order Notes

Procurement Quality Clauses

A005 right of entry
A012 chemical and physical test report
A016 personnel qualification
A017 raw material identification (as applicable)

A022 Apical Processing
A024 process certifications
A026 certification of material conformance

A041 quality management system
A042 dart notification by supplier
A043 retention of quality documents

A048 counterfeit parts avoidance, detection, mitigation and disposition program

A049 supplier awareness

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 2/5/19 2:07 PM dart.tsimiklis.chrisoula

**skyservice****Work Order Traveler**
Sky Service F.B.O. Inc.

10105 Ryan Avenue, Dorval, Quebec, H9P 1A2

TCCA AMO 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO39182	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: P 004 2487
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:**CARRY OUT NDT ON:**

2 FWD CROSSTUBES , P/N# D212-664-107 , J/S# 188444 , 188445

2 FWD CROSSTUBES , P/N D212-664-101 , J/S# 189456 , 189457

2 AFT CROSSTUBES , P/N# D212-664-201 , J/S# 189169 , 183772

4 FWD CROSSTUBES , P/N# D206-667-101 , J/S# 188686 , 188683 , 188684 , 188685

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-16							
NO CRACK FOUND							
PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923 , DEV. MPO11715 , UV LIGHT M-20142						FEB 04 2019	
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:	ACA/SCA Stamp 	Date: FEB 04 2019
Name: HATTE MELIKIAN		